Smart-Boost™ Rotary Converters SB-60

Quick **Specs**

Single Phase Input: 208 - 245 Volts

3 Phase Rated Output: 208 - 245 Volts

Minimum Single Phase Circuit: 150 Amps

Best Performance Single Motor Start: 30HP

Recommended 3 Phase Sizing: 72 Amps

Voltage Balance: Based on input +/-5-10%

Professional. Powerful. Affordable. Smart-Boost™ offers more than you would expect from a phase converter. Unparalleled starting power for the toughest starting applications.


Control Panel Features

- **600% Motor Starting Boost Current**
- **Built-In Motor Starter with Start/ Stop Push Button Switch**
- **Digitally Controlled with Solid State Switches**
- **Complete Phase Power Failure Protection**
- Power "ON" Indicator Light
- **Voltage Differential Technology**
- 10 Year Parts / Lifetime Labor Warranty
- Made In the USA



Idler Generator Features

- **Custom Made Rotary Phase Converter** Generators
- Low Impedance/High Efficiency Design
- **Custom Copper Windings and Rotor**
- Made by ABB / Baldor Electric USA
- Available in ODP and TEFC
- **Shielded Windings**
- Made In the USA

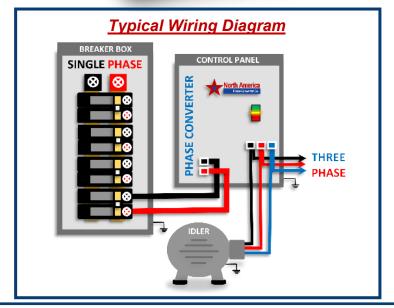





Specifications SB-60

Model	
Brand	NAPCES
Line	Smart-Boost™
Model #	SB-60
General Specifications	
Horse Power (HP)	60
Kilo-watt (kW)	44.7
Frequency (Hz)	60
Generator Type	ODP
Enclosure Type	NEMA 1 (Indoor)
Generator Frame	364
Single Phase Electrical Specifications	
Voltage Input	208-245
Minimum Fuse Size	150
Minimum Circuit Breaker Size	150
Maximum Fuse Size	300
Maximum Circuit Breaker Size	300
Minimum Wire Input	350 MCM or 125% of circuit size
Idle Amperage	18.57
Three Phase Electrical Specifications	
Voltage Output	208-245 based on input voltage
Output Amperage	149
Voltage Balance	5-10%
Minimum Wire to Generator	3/0 AWG
Minimum Wire to Load	3/0 AWG or based on load
Dimensions & Weights	
Enclosure (H X W X D)	30" X 28" X 42"
Installation Clarence (all sides)	12" to 18"
Approx. Total Shipping Weight	673 lbs.

The SB-60 Smart-Boost™ Phase Converter is best sized for:	
Easy / Light Motor Loads - up to 50 HP	
Examples of Easy Loads: Table Saw, Milling Machine ,Drill Press	
Medium Motor Loads - up to 40 HP	
Examples of Medium Loads: Belt Sander, Grinder, Mixer	
Hard Motor Loads - up to 30 HP	
Examples of Hard Loads: Gearhead Lathe, Dust Collector , Fan	
Very Hard Motor Load - up to 30 HP	
Examples of Very Hard Motor Loads: Air Compressor, Sub. Pump	
CNC, Resistive and Inductive Loads - 72 Amps @240 Volts	

Sizing Notes SB-60

For light/easy motor loads: Size rotary phase converter 1.25 times larger then the motor load

For medium motor loads: Size rotary phase converter 1.5 times larger then the motor load

For heavy/hard motor loads: Size rotary phase converter double the size of motor load

For very hard motor loads: Size rotary phase converter double the size of motor load

For CNC, resistive and inductive loads: Recommend *Pro-Line* or Smart-PhaseTM

Available Accessories



Wired and Wireless Remote Switches



Twist-Lock Outlets and Plugs



Rubber Isolation Mounting Feet



